	FOF DEFICIENCIES OF CORRECTION	(X1) PROVIDER/SUPPLIER/CUA IDENTIFICATION NUMBER:	1 ' '	PLE CONSTRUCTION G 01 - MAIN BUILDING 01		TE SURVEY MPLETED
POCHI	original	445166		#) #) # # # # # #	06	/06/2017
	PROVIDER OR SUPPLIER ALTH CENTER AT RIC	CHLAND PLACE		STREET ADDRESS, CITY, STATE, ZIP CODE 504 ELMINGTON AVENUE NASHVILLE, TN 37205		
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD CROSS-REFERENCED TO THE APPROFIDERICIENCY)	D BE	(XS) COMPLETIC DATE
K 000	INITIAL COMMENT	s	K000			
	State of Tennessee Division of Health L Office of Health Car 06/06/2017. During Health Center at Ric substantial complian participation in Med Subpart 483.?0(a), related National Fire (NFPA) standard 10 The requirement at is NOT MET as evic NFPA 101 Vertical Openings - 2012 EXISTING Stairways, elevator shafts, chutes, and between floors are chaving a fire resistal An atrium may be us 19.3.1.1 through 19. If all vertical opening construction providir resistance rating, also box. This STANDARD is This deficiency affect compartments. Based on observation and the findings include	42 (CFR), Subpart 483.?0(a) denced by: Openings - Enclosure Enclosure shafts, light and ventilation other vertical openings enclosed with construction nce rating of at least 1 hour. sed in accordance with 8.6. 3.1.6 gs are properly enclosed with ng at least a 2-hour fire so check this not met as evidenced by: sted 1 of 10 smoke ons, the facility failed to openings. d:	K 311	Stairwell leading from the parking Garage to the health care center wi sealed with fire caulking. Maintena Director will ensure completion and Survey other penetrations on camp ensure compliance as well. Mainte Dir will inspect all future penetration created from construction or renova are properly sealed and other main staff will be trained on this requirem ensure compliance. RECEIVED JUN - 8 2017 Health Care Facilities	nce will us to nance is ations tenance	7/15/20 ⁻
BORATORY	DIRECTOR'S OR PROVIDE	R/SUPPLIERREPRESENTATIVE'S SIGNA	TURE	A TITLE		(X6) DATE
y deficiency	riotina ko	ne-		(dolministrikur	(0/22/1

FORM CMS-2567(02-99) Previous Versions Obsolete

Event ID: O29L21

Facility ID: TN1910

If continuation sheet Page 1 of 8

PRINTED: 06/08/2017

FORM CMS-2567 (02-99) Previous Versions Obsolete

PRINTED: 06/08/2017 FORM APPROVED 0MB NO 0938-0391

	T OF DEFICIENCIES OF CORRECTION	(X1) PROVIDER/SUPPLIER/CUA IDENTIFICATION NUMBER:	` '	PLE CONSTRUCTION 6 01 - MAIN BUILDING 01		E SURVEY IPLETED
		445166	B WIN_G		06/	06/2017
	PROVIDER OR SUPPLIER	HLAND PLACE		STREET ADDRESS, CITY, STATE, ZIP CODE 504 ELMINGTON AVENUE NASHVILLE, TN 37205		
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTIO (EACH CORRECTIVE ACTION SHOULD CROSS-REFERENCED TO THE APPROPI DEFICIENCY)	DBE	(XS) COMPLETIO DATE
K 311	Observation on 06/2 ½ inch steel pipe the door, in the bloc from the parking ga center. NFPA 101, 101, 19.3.1 (2012 E	D6/2017 at 11:25 AM, revealed penetration not sealed, above k wall of the stairwell leading rage into the health care 3.3.5 (2012 Edition) NFPA dition) Tas present when the entified and the administrator leficiencies during the exit	K 311			
K 321 SS=D	NFPA 101 Hazardo Hazardous Areas - 2012 EXISTING Hazardous areas ar having 1-hour fire refire rated doors) or a system in accordance approved automatic option is used, the a other spaces by smodors in accordance self-closing or autom have nonrated or fie that do not exceed 4 the door. Describe the floor ar	e protected by a fire barrier sistance rating (with 3/4-hour an automatic fire extinguishing se with 8.7.1. When the fire extinguishing system reas shall be separated from the existing partitions and with 8.4. Doors shall be natic-closing and permitted to ld-applied protective plates 8 inches from the bottom of		The electrical cord preventing se closure of the kitchen dry goods storage room door was removed 6/7/2017. All Maintenance staff wensure that no Other electrical coare being used In the center in a that would put Safety at risk (fire or general Safety) Maintenance director will Educate staff on electord safety At the July staff meet Completion by July 14, 2017. The penetration in the ceiling of the Elevator equipment room will be with fire caulk by maintenance di Maintenance Director will check to other penetrations and seal as not the materials filling the conduit as	on vill ords way safety trical ings. he sealed rector. for eeded. nd	7/14/20 ⁻
	a. Boiler and Fuel-Fib. Laundries (largerc. Repair, Maintenar	than 100 squarefeet) nce, and PaintShops ns (exceeding 64 gallons)		metal clad cable penetration will removed and replaced with fire- stopping materials by maintenand director as required by K321.	be	7/14/201

RECEIVED

Event ID: O29L21

S 20'7

Facility ID: TN1910



BY:____

If continuation sheet Page 2 of 8

PRINTED: 06/08/2017 FORM APPROVED 0MB NO 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CUA IDENTIFICATION NUMBER:	(X2) MULTIPLE CONSTRUCTION A. BUILDING 01 - MAIN BUILDING 01			(X3) DATE SURVEY COMPLETED	
	PROVIDER OR SUPPLIER	STREET ADDRESS, CITY, STATE, ZIP CODE 504 ELMINGTON AVENUE WAS LIVED TO 177205		STREET ADDRESS, CITY, STATE, ZIP CODE			
(X4) ID PREFIX TAG	(EACH DEFICIENCY	ATEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREF TAG	ıx	PROVIDER'S PLAN OF CORRECTIO (EACH CORRECTIVE ACTION SHOULD CROSS-REFERENCED TO THE APPROP DEFICIENCY)) BE	(X5) COMPLETIO DATE
	This deficiency affer compartments. Based on observation maintain the hazard. The finding included. 1. Observation on 0 revealed an electric doorway of the kitch preventing it from set NFPA 101, 19.3.2.3. 2. Observation on 0 revealed a 4" steel preventing of the NFPA 101, 8.3.5 (20 19.3.2.1 (2012 Editions). 3. Observation on 0 revealed conduit and filled with mixed firedoor in the transfer set (2012 Edition). NFPA Maintenance staff with deficiencies were idea.	age Rooms/Spaces t) lassified as Severe s not met as evidenced by: cted 2 of 10 smoke ons, the facility failed to dous areas. d: 6/06/2017 at 10:54 AM, al cord running through the en dry goods storage room elf-closing within the frame. (2012 Edition) 6/06/2017 at 11:19 AM, bipe penetration in the ne elevator equipment room. 12 Edition) NFPA 101, on) 6/06/2017 at 11:45 AM, d metal clad cable penetration estopping materials above the switch room. NFPA 101, 8.3.5 a 101, 19.3.2.1 (2012 Edition) as present when the entified and the administrator eficiencies during the exit	K	321			
K 324 SS=D	NFPA 101 Cooking F	Facilities	K3:	24			

FORM CMS-2567(02-99) Previous Versions Obsolete

Event ID: O29L21

Facility ID: TN1910

If continuation sheet Page 3 of 8

RECEIVED

JUN - 8 2017

PRINTED: 06/08/2017 FORM APPROVED 0MB NO 0938-0391

	T OF DEFICIENCIES OF CORRECTION	(X1) PROVIDER/SUPPLIER/CUA IDENTIFICATION NUMBER:	(X2) MULTIPLE CONSTRUCTION A. BUILDING 01 - MAIN BUILDING 01			(X3) DATE SURVEY COMPLETED	
		445166	B. WING	-		06/	06/2017
THE HEALTH CENTER AT RICHLAND PLACE				STREET ADDRESS, CITY, STATE, ZIP CODE 504 ELMINGTON AVENUE NASHVILLE, TN 37205			
(X4) ID PREFIX TAG	(EACH DEFICIENCY I	TEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFI TAG		PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD CROSS-REFERENCED TO THE APPROPR DEFICIENCY)	BE	(XS) COMPLETION DATE
K 324	Cooking Facilities Cooking equipment with NFPA 96, Stand and Fire Protection Operations, unless: * residential cooking appliances such as toasters) are used for cooking in accordant * cooking facilities or compartments with 3 with the conditions un or * cooking facilities in 30 or fewer patients 18.3.2.5.4, 19.3.2.5.4 Cooking facilities pro per 9.2.3 are not rechazardous areas, bu corridor.	is protected in accordance dard for Ventilation Control of Commercial Cooking gequipment (i.e., small microwaves, hot plates, or food warming or limited ace with 18.3.2.5.2, 19.3.2.5.2 pen to the corridor in smoke 30 or fewer patients comply nder 18.3.2.5.3, 19.3.2.5.3, a smoke compartments with comply with conditions under 4. Directed according to NFPA 96 quired to be enclosed as at shall not be open to the	КЗ		Kitchen staff will receive additional transproper kitchen fire procedures, incorprocedures related to manual activate kitchen hood suppression system training will be conducted by the dietamanager and the maintenance direct	cluding ion of n. This ary	7/14/2017
	This STANDARD is This deficiency affect compartments.	not met as evidenced by: ted 1 of 10 smoke					
	Based on interview, the cooking facilities	the facility failed to protect					
	The findings included	d;					
	06/06/2017 at 11:00 member was not fam	n staff member #1 on AM, revealed the staff niliar with the proper kitchen ding manual activation of the					

FORM CMS-2567 (02-99) Previous Versions Obsolete

Event ID: O29L21

Facility ID: TN1910

If continuation sheet Page 4 of 8

RECEIVED

JUN -8 20'7

Health care Facilities

PRINTED: 06/08/2017 FORM APPROVED 0MB NO. 0938-0391

. OFITE	NOT ON WILDIOANL	& MEDICAID SERVICES				AID IAC	<u>). 0930-0391</u>
	T OF DEFICIENCIES OF CORRECTION	(X1) PROVIDER/SUPPLIER/CUA IDENTIFICATION NUMBER:			LE CONSTRUCTION 01 - MAIN BUILDING 01		E SURVEY IPLETED
		445166	B. WIN_C	3 _	1 100 E 10 100 W 100 E 100 E	06	06/2017
	PROVIDER OR SUPPLIER ALTH CENTER AT RIC	CHLAND PLACE	NASHVILLE, IN 3/205				
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFI TAG		PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD CROSS-REFERENCED TO THE APPROPF DEFICIENCY)	BE	(X5) COMPLETION DATE
K 324	kitchen hood suppri 19.3.2.5.3 (2012 Edition) Maintenance staff wideficiencies were id acknowledged the control of the contro	ession system. NFPA 101, dition) NFPA96, 10.5.7 (2011 was present when the lentified and the administrator deficiencies during the exit	КЗ	24			
K 511 SS=D	complies with NFPA electrical wiring and NFPA 70, National I	Gas and Electric Electric as or related gas piping 54, National Fuel Gas Code, equipment complies with Electric Code. Existing attinue in service provided no	K 5		K 511 Restraint device will be added to the grill in the kitchen that is currently mon castors without a restraint device will be completed by the maintenance director. Maintenance Director will check all equipment using gas or related gas processories it meets this regulatory requirement.	This e	7/14/2017
	This deficiency affect compartments. Based on observation maintain the utilities. The findings include Observation on 06/0 the gas grill in the kit castors without a res	ons, the facility failed to d: 6/2017 at 10:57 AM, revealed tchen was mounted on straint device. NFPA 101, NFPA 101, 9.1.1 (2012 6.1.2 (2012 Edition)					

FORM CMS-2567(02-99)Previous Versions Obsolete

Event ID: 029L21

Facility ID: TN1910

If continuation sheet Page 5 of 8

RECEIVED

JUN - 8 20'7

PRINTED: 06/08/2017 FORM APPROVED 0MB NO. 0938-0391

	T OF DEFICIENCIES OF CORRECTION	(X1) PROVIDER/SUPPLIER/CUA IDENTIFICATION NUMBER:	l ' '	PLE CONSTRUCTION G 01 - MAIN BUILDING 01	1 ' '	TE SURVEY MPLETED
		445166	B. WING		06	/06/2017
	PROVIDER OR SUPPLIER ALTH CENTER AT RIC	CHLAND PLACE		STREET ADDRESS, CITY, STATE, ZIP CODE 504 ELMINGTON AVENUE NASHVILLE, TN 37205		
(X4) ID PREFIX TAG	(EACH DEFICIENCY	ATEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVEACTION SHOUL CROSS-REFERENCED TO THE APPROF	D BE	(XS) COMPLETION DATE
K 511 K 741	deficiencies were id	dentified and the administrator deficiencies during the exit 6/2017.	K 51			
SS=D	Smoking Regulation Smoking regulation include not less that (1) Smoking shall be ward, or compartme combustible gases, and in any other has area shall be posted SMOKING or shall be international symbo (2) In health care of prohibited and signs major entrances, set that prohibits smokin (3) Smoking by patieresponsible shall be (4) The requirement where the patient is (5) Ashtrays of nonce design shall be proving smoking is permitted (6) Metal containers devices into which a be readily available to permitted. 18.7.4, 19.7.4 This STANDARD is	s shall be adopted and shall n the following provisions: e prohibited in any room, ant where flammable liquids, or oxygen is used or stored zardous location, and such d with signs that read NO be posted with the I for no smoking. Ecupancies where smoking is are prominently placed at all econdary signs with language and shall not be required. The ents classified as not prohibited. The following shall not apply under direct supervision. Ecombustible material and safe yield in all areas where d. With self-closing cover shtrays can be emptied shall to all areas where smoking is not met as evidenced by: ons, the facility failed to gregulations.		Metal can without self-closing lid waremoved immediately when noted of survey. Can will be replaced with a with a self-closing lid. This will be completed by the maintenance dire	luring can	7/14/2017

Facility ID: TN1910

	T OF DEFICIENCIES OF CORRECTION	(X1) PROVIDER/SUPPLIER/CUA IDENTIFICATION NUMBER:				
		445166	B. WING	2 5 5 5 5 F B B B B	06/0	06/2017
	PROVIDER OR SUPPLIER ALTH CENTER AT RIC	CHLAND PLACE		STREET ADDRESS, CITY, STATE, ZIP CODE 504 ELMINGTON AVENUE NASHVILLE, TN 37205		
(X4) ID PREFIX TAG	(EACH DEFICIENCY	TEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFIX TAG	PROVIDER'S PLAN OF CORRECTIO (EACH CORRECTIVE ACTION SHOULD CROSS-REFERENCED TO THE APPROPI DEFICIENCY)	DBE	(XS) COMPLETION DATE
	Observation on 06/no metal can with a disposal. NFPA 10: Maintenance staff v deficiencies were in acknowledged the conference on 06/0 NFPA 101 Gas Equipment - Container Storage Gas Equipment - Container Storage Gas Equipment - Container Storage locations a ventilated in accord 5.1.3.3.3. >300 but <3,000 cu Storage locations a within an enclosed i limited combustible gates outdoors) that gases are not stored separated from composprinklered) or enclonocombustible con 1/2 hr. fire protection Less than or equal to 1/2 hr. fire protection Less than or equal to 300 cubic stored in an enclosure handled with precaut A precautionary sign	o6/2017 at 11:22 AM, revealed a self-closing lid for ash waste 1, 19.7.4 (2012 Edition) was present when the lentified and the administrator deficiencies during the exit 6/2017. hipment- Cylinder and ylinder and Container Storage al to 3,000 cubic feet re designed, constructed, and ance with 5.1.3.3.2 and bic feet re outdoors in an enclosure or neterior space of non- or construction, with door (or can be secured. Oxidizing dwith flammables, and are bustibles by 20 feet (5 feet if osed in a cabinet of struction having a minimum nerating. o 300 cubic feet compartment, individual continued in the content of the	K 741		vey. Anents	7/28/2017

FORM CMS-2567(02-99) Previous Versions Obsolete

Event ID: 029L21

Facility ID: TN191D

If continuation sheet Page 7 of 8

RECEIVED

JUN -8 2017

PRINTED: 06/08/2017 FORM APPROVED 0MB NO. 0938-0391

	T OF DEFICIENCIES OF CORRECTION	(X1) PROVIDER/SUPPLIER/CUA IDENTIFICATION NUMBER:				ATE SURVEY OMPLETED	
		445166	B. WING			06/	06/2017
NAMEOFI	DOWNER OF CHERLIER	443100		-	STREET ADDRESS, CITY, STATE, ZIP CODE	00/	00/201/
NAME OF I	PROVIDER OR SUPPLIER						
THE HE	ALTH CENTER AT RIC	CHLAND PLACE			504 ELMINGTON AVENUE		
				L	NASHVILLE, TN 37205		
(X4) ID PREFIX TAG	(EACH DEFICIENCY	ATEMENT OF DEFICIENCIES MUST BE PRECEDED BY FULL SC IDENTIFYING INFORMATION)	ID PREFI TAG		PROVIDER'S PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD CROSS-REF ERENCED TO THE APPROPE DEFICIENCY)	BE	(X5) COMPLETION DATE
K 923	Storage is planned of which they are re Empty cylinders are cylinders. When facintegral pressure gas considered empty is are marked to avoid in the open are protour 11.3.1, 11.3.2, 11.3.3 This STANDARD is Based on observation maintain the oxygen The findings include Observation on 06/054 "E" sized cylinder within 5 feet of comband boxed storage). Edition) NFPA 99, 1 Maintenance staff with deficiencies were idea.	so cylinders are used in order received from the supplier. It is segregated from full sility employs cylinders with received at the shold pressure is established. Empty cylinders it confusion. Cylinders stored rected from weather. It is is in the facility failed to recylinder storage. It is is in the facility failed to recylinder storage. It is is in central supply results a stored in central suppl	K9	923			

FORM CMS-2567(02-99) Previous Versions Obsolete

Event ID: 029L21

Facility ID: TN1910

If continuation sheet Page 8 of 8

RECEIVED

JUN - 8 2017